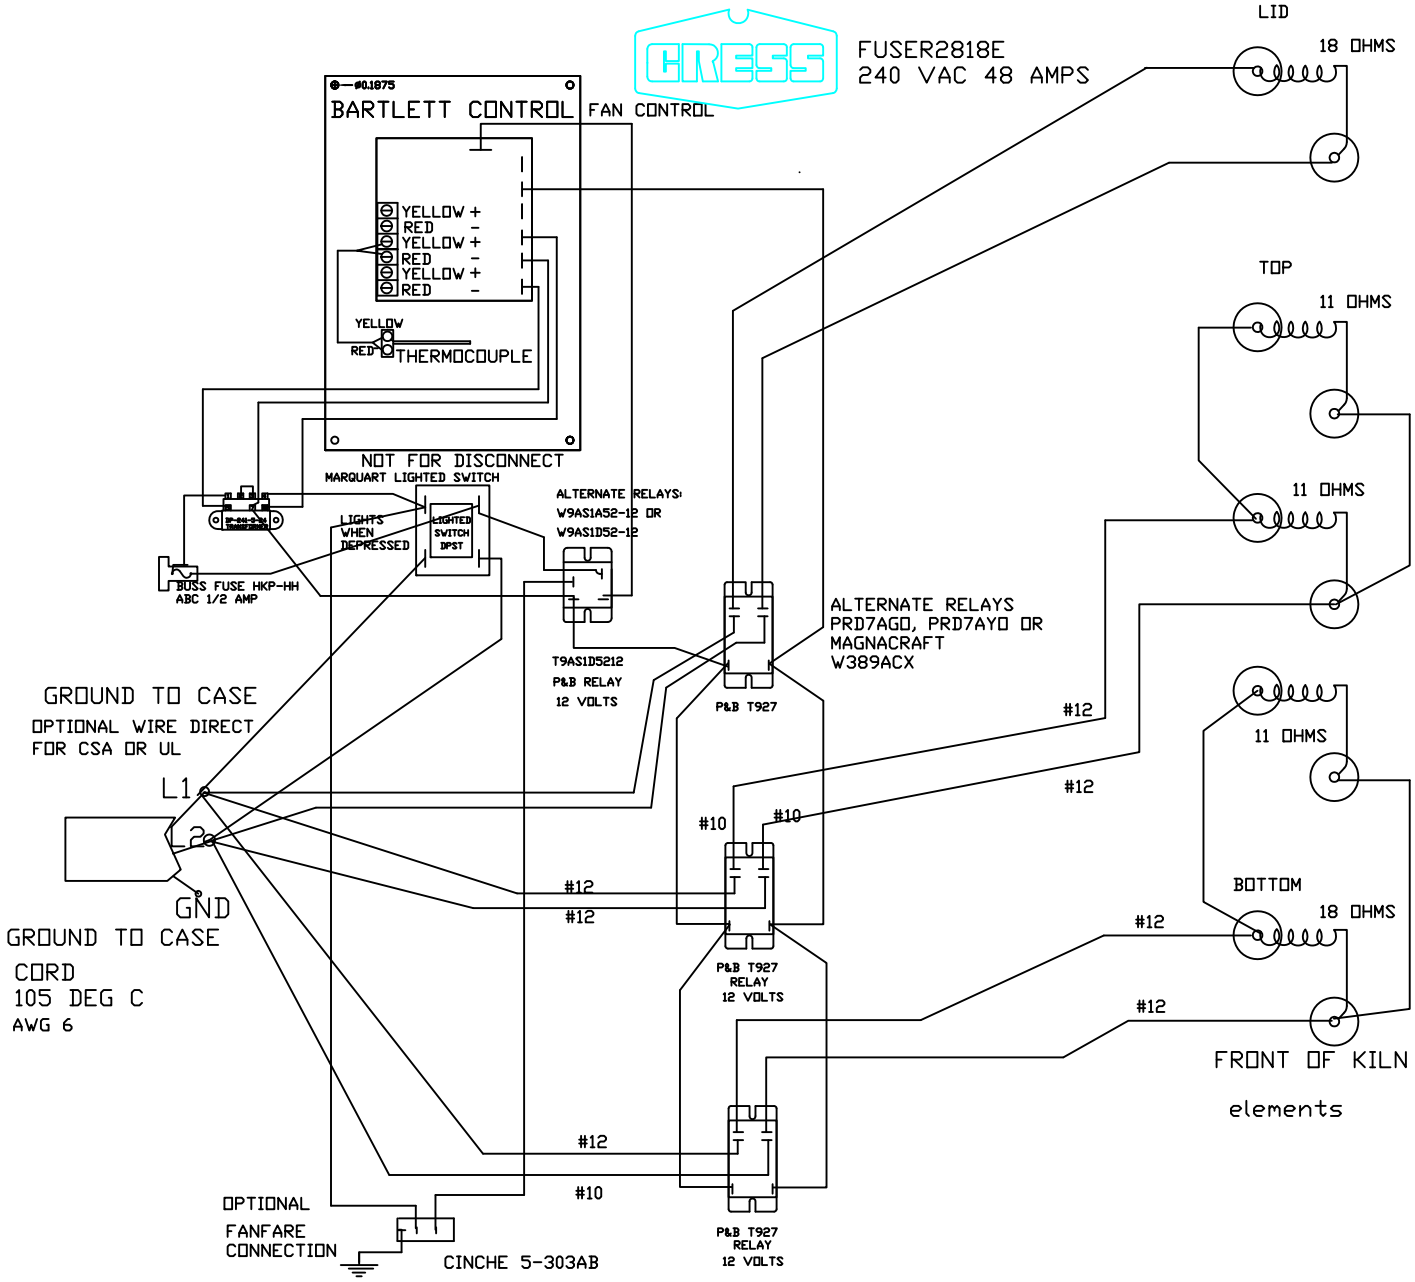
CRESS
FUSER2818E
240 VAC 48 AMPS
LID
18 OHMS
BARTLETT CONTROL
FAN CONTROL
YELLOW +
RED -
YELLOW +
RED -
YELLOW +
RED -
YELLOW
RED
THERMOCOUPLE
NOT FOR DISCONNECT
MARQUART LIGHTED SWITCH
LIGHTS WHEN DEPRESSED
LIGHTED SWITCH DPST
ALTERNATE RELAYS:
W9AS1A52-12 OR
W9AS1D52-12
BUSS FUSE HKP-HH
ABC 1/2 AMP
T9AS1D5212
P&B RELAY
12 VOLTS
P&B T927
ALTERNATE RELAYS
PRD7AGD, PRD7AYD OR
MAGNACRAFT
W389ACX
TOP
11 OHMS
11 OHMS
11 OHMS
BOTTOM
18 OHMS
FRONT OF KILN
elements
GROUND TO CASE
OPTIONAL WIRE DIRECT
FOR CSA OR UL
L1
L2
GND
GROUND TO CASE
CORD
105 DEG C
AWG 6
#12
#10
P&B T927
RELAY
12 VOLTS
OPTIONAL
FANFARE
CONNECTION
CINCHE 5-303AB